



SAFETY DATA SHEET

SECTION 1) CHEMICAL PRODUCT AND MANUFACTURER'S IDENTIFICATION

Product ID: 603
Product Name: STINGER QUICK VINYL & PLASTIC COATING
Revision Date: Jul 21, 2020
Version: 3.0
Distributor's Name: STINGER CHEMICAL
Address: 1100 PLEASANTVILLE DR. - HOUSTON, TX 77029
Emergency Phone: CHEMTREC: 800-424-9300
Information Phone Number: (713) 227-1340
Product/Recommended Uses: Vinyl / Plastic Coating

Date Printed: Jul 22, 2020


Supersedes Date: Dec 03, 2018

SECTION 2) HAZARDS IDENTIFICATION

Classification

Aerosols - Category 1
Gases Under Pressure - Liquefied Gas
Aspiration Hazard - Category 1
Skin Irritation - Category 2
Reproductive Toxicity - Category 2
Specific Target Organ Toxicity - Repeated Exposure - Category 2
Specific Target Organ Toxicity - Single Exposure (Narcotic Effects) - Category 3

Pictograms



Signal Word

Danger

Hazardous Statements - Physical

H222 - Extremely flammable aerosol
H280 - Contains gas under pressure; may explode if heated

Hazardous Statements - Health

H304 - May be fatal if swallowed and enters airways
H315 - Causes skin irritation
H361 - Suspected of damaging fertility
H373 - May cause damage to organs through prolonged or repeated exposure.
H336 - May cause drowsiness or dizziness

Precautionary Statements - General

P101 - If medical advice is needed, have product container or label at hand.
P102 - Keep out of reach of children.

P103 - Read label before use.

Precautionary Statements - Prevention

P210 - Keep away from heat, hot surfaces, sparks, open flames and other ignition sources. No smoking.

P211 - Do not spray on an open flame or other ignition source.

P251 - Do not pierce or burn, even after use.

P201 - Obtain special instructions before use.

P202 - Do not handle until all safety precautions have been read and understood.

P280 - Wear protective gloves, protective clothing, eye protection and face protection.

P264 - Wash hands thoroughly after handling.

P260 - Do not breathe mist, vapors or spray.

P271 - Use only outdoors or in a well-ventilated area.

Precautionary Statements - Response

P314 - Get medical attention if you feel unwell.

P308 + P313 - IF exposed or concerned: Get medical attention.

P301 + P310 - IF SWALLOWED: Immediately call a POISON CENTER or doctor.

P331 - Do NOT induce vomiting.

P302 + P352 - IF ON SKIN: Wash with plenty of soap and water.

P332 + P313 - If skin irritation occurs: Get medical attention.

P362 + P364 - Take off contaminated clothing and wash it before reuse.

P304 + P340 - IF INHALED: Remove person to fresh air and keep comfortable for breathing.

P312 - Call a POISON CENTER or doctor if you feel unwell.

Precautionary Statements - Storage

P410 + P412 - Protect from sunlight. Do not expose to temperatures exceeding 50°C / 122°F.

P405 - Store locked up.

P403 - Store in a well-ventilated place.

Precautionary Statements - Disposal

P501 - Dispose of contents and container in accordance with local, regional, national and international regulations.

SECTION 3) COMPOSITION, INFORMATION ON INGREDIENTS

| CAS | Chemical Name | % By Weight |
|--------------|---------------------------------------|-------------|
| 0000110-54-3 | HEXANE | 38% - 63% |
| 0063148-62-9 | Silicone | 17% - 29% |
| 0068476-86-8 | Petroleum gases, liquefied, sweetened | 14% - 23% |

Specific chemical identity and/or exact percentage (concentration) of the composition has been withheld to protect confidentiality.

SECTION 4) FIRST-AID MEASURES

Inhalation

Remove source of exposure or move person to fresh air and keep comfortable for breathing.

If exposed/feel unwell/concerned: Call a POISON CENTER or doctor.

Eliminate all ignition sources if safe to do so.

Eye Contact

Remove source of exposure or move person to fresh air. Rinse eyes cautiously with lukewarm, gently flowing water for several minutes, while holding the eyelids open. Remove contact lenses, if present and easy to do. Continue rinsing for a duration of 15-20 minutes. Take care not to rinse contaminated water into the unaffected eye or onto the face. If eye irritation persists: Get medical advice/attention.

Skin Contact

Take off contaminated clothing, shoes and leather goods (e.g. watchbands, belts). Wash with plenty of lukewarm, gently flowing water for a duration of 15-20 minutes. If skin irritation occurs: Get medical advice/attention. Wash contaminated clothing before reuse.

IF exposed or concerned: Get medical advice/attention.

Ingestion

Immediately call a POISON CENTER or doctor. Do NOT induce vomiting. If vomiting occurs naturally, lie on your side, in the recovery position.

Most Important Symptoms/Effects, Acute and Delayed

No data available.

Indication of Immediate Medical Attention and Special Treatment Needed

No data available.

SECTION 5) FIRE-FIGHTING MEASURES

Suitable Extinguishing Media

Dry chemical, foam, carbon dioxide. Water spray may be useful in minimizing or dispersing vapors and to protect personnel. Carbon dioxide can displace oxygen. Use caution when applying carbon dioxide in confined spaces. Simultaneous use of foam and water on the same surface is to be avoided as water destroys the foam. Sand or earth may be used for small fires only.

Do not direct a solid stream of water or foam into hot, burning pools. This may result in frothing and increased fire intensity.

Unsuitable Extinguishing Media

No data available.

Specific Hazards in Case of Fire

Contents under pressure. Keep away from ignition sources and open flames. Exposure of containers to extreme heat and flames can cause them to rupture often with violent force. Product is highly flammable and forms explosive mixtures with air, oxygen, and all oxidizing agents. Vapors are heavier than air and may travel along surfaces to remote ignition sources and flash back.

During a fire, irritating and highly toxic gases may be generated during combustion or decomposition. High temperatures can cause sealed containers to rupture due to a build up of internal pressures. Cool with water.

Empty Containers retain product residue which may exhibit hazards of material; therefore do not pressurize, cut, glaze, weld or use for any other purposes.

Fire-Fighting Procedures

Isolate immediate hazard area and keep unauthorized personnel out. Stop spill/release if it can be done safely. Move undamaged containers from immediate hazard area if it can be done safely. Water spray may be useful in minimizing or dispersing vapors and to protect personnel. Water may be ineffective but can be used to cool containers exposed to heat or flame. Caution should be exercised when using water or foam as frothing may occur, especially if sprayed into containers of hot, burning liquid.

Dispose of fire debris and contaminated extinguishing water in accordance with official regulations.

Special Protective Actions

Wear protective pressure self-contained breathing apparatus (SCBA) and full turnout gear.

SECTION 6) ACCIDENTAL RELEASE MEASURES

Emergency Procedure

ELIMINATE all ignition sources (no smoking, flares, sparks or flames in immediate area).

Do not touch or walk through spilled material.

Isolate hazard area and keep unnecessary people away. Remove all possible sources of ignition in the surrounding area. Notify authorities if any exposure to the general public or the environment occurs or is likely to occur.

If spilled material is cleaned up using a regulated solvent, the resulting waste mixture may be regulated.

Recommended Equipment

Wear liquid tight chemical protective clothing in combination with positive pressure self-contained breathing apparatus (SCBA).

Personal Precautions

Avoid breathing vapor. Avoid contact with skin, eye or clothing. Do not touch damaged containers or spilled materials unless wearing appropriate protective clothing.

Environmental Precautions

Stop spill/release if it can be done safely. Prevent spilled material from entering sewers, storm drains, other unauthorized drainage systems and natural waterways by using sand, earth, or other appropriate barriers.

Methods and Materials for Containment and Cleaning up

Absorb liquids in vermiculite, dry sand, earth, or similar inert material and deposit in sealed containers for disposal.

SECTION 7) HANDLING AND STORAGE

General

Do not puncture or incinerate (burn) cans. Do not stick pins, nails, or any other sharp objects into opening on top of can. Do not spray in eyes. Do not take internally.

Ventilation Requirements

Use in a well-ventilated place.

Storage Room Requirements

Store and use in a cool, dry, well-ventilated area. Do not store above 120°F. See product label for additional information.

SECTION 8) EXPOSURE CONTROLS/PERSONAL PROTECTION

Eye Protection

Wear safety glasses with side shields. Eyewash stations and showers should be available in areas where this material is used and stored.

Skin Protection

Use solvent-resistant protective gloves for prolonged or repeated contact.

Respiratory Protection

Avoid breathing vapors. In restricted areas, use approved chemical/mechanical filters designed to remove a combination of particles and vapor. In confined areas, use an approved air line respirator or hood. A self-contained breathing apparatus is required for vapor concentrations above PEL/TLV limits.

Appropriate Engineering Controls

Ventilation should be sufficient to prevent inhalation of any vapors.

| Chemical Name | OSHA TWA (mg/m3) | OSHA TWA (ppm) | OSHA STEL (mg/m3) | OSHA Carcinogen | OSHA Skin designation | OSHA Tables (Z1, Z2, Z3) | ACGIH TWA (mg/m3) | ACGIH TWA (ppm) |
|---------------------------------------|------------------|----------------|-------------------|-----------------|-----------------------|--------------------------|-------------------|-----------------|
| HEXANE | 1800 | 500 | | | | 1 | | 50 |
| Petroleum gases, liquefied, sweetened | 2000 | 500 | | | | 1 | | |

| Chemical Name | NIOSH STEL (ppm) | ACGIH STEL (mg/m3) | ACGIH STEL (ppm) | ACGIH Carcinogen | ACGIH TLV Basis | ACGIH Notations | NIOSH TWA (mg/m3) | NIOSH TWA (ppm) |
|---------------------------------------|------------------|--------------------|------------------|------------------|--|-----------------|-------------------|-----------------|
| HEXANE | | | | | CNS impair; peripheral neuropathy; eye irr | Skin; BEI | 180 | 50 |
| Petroleum gases, liquefied, sweetened | | | | | | | | |

| Chemical Name | NIOSH STEL (mg/m3) | OSHA STEL (ppm) | NIOSH Carcinogen |
|---------------------------------------|--------------------|-----------------|------------------|
| HEXANE | | | |
| Petroleum gases, liquefied, sweetened | | | |

(C) - Ceiling limit, BEI - Substances for which there is a Biological Exposure Index or Indices, CNS - Central nervous system, impair - Impairment, irr - Irritation

SECTION 9) PHYSICAL AND CHEMICAL PROPERTIES

Physical and Chemical Properties

Density 5.81 lb/gal

| | |
|-----------------------|-----------------------------|
| Density VOC | 4.35 lb/gal |
| % VOC | 74.8% |
| Appearance | N.A. |
| Odor Threshold | N.A. |
| Odor Description | N.A. |
| pH | N.A. |
| Water Solubility | N.A. |
| Flammability | Flash point below 73°F/23°C |
| Vapor Pressure | 103.787 mmHg |
| Flash Point | N.A. |
| Viscosity | N.A. |
| Lower Explosion Level | N.A. |
| Upper Explosion Level | N.A. |
| Vapor Density | N.A. |
| Melting Point | N.A. |
| Freezing Point | N.A. |
| Low Boiling Point | N.A. |
| High Boiling Point | N.A. |
| Decomposition Pt | N.A. |
| Auto Ignition Temp | N.A. |
| Evaporation Rate | Slower than ether |

SECTION 10) STABILITY AND REACTIVITY

Stability

Stable under normal storage and handling conditions.

Conditions to Avoid

Avoid heat, sparks, flame, high temperature and contact with incompatible materials.
Dropping containers may cause bursting.

Incompatible Materials

Avoid strong oxidizers, reducers, acids, and alkalis.

Hazardous Reactions/Polymerization

Will not occur.

Hazardous Decomposition Products

No data available.

SECTION 11) TOXICOLOGICAL INFORMATION

Skin Corrosion/Irritation

Causes skin irritation

Likely Route of Exposure

Inhalation, ingestion, skin absorption.

Serious Eye Damage/Irritation

No data available.

Carcinogenicity

No data available.

Germ Cell Mutagenicity

No data available.

Reproductive Toxicity

Suspected of damaging fertility

Respiratory/Skin Sensitization

No data available.

Specific Target Organ Toxicity - Single Exposure

May cause drowsiness or dizziness

Specific Target Organ Toxicity - Repeated Exposure

May cause damage to organs through prolonged or repeated exposure.

Aspiration Hazard

May be fatal if swallowed and enters airways

Acute Toxicity

0000110-54-3 HEXANE

LC50 (male rat): 38500 ppm (4-hour exposure); cited as 77000 ppm (271040 mg/m3) (1-hour exposure) (15)

LC50 (rat): 48000 ppm (4-hour exposure) (16)

LC50 (rat): 73680 ppm (260480 mg/m3) (4-hour exposure) (n-hexane and isomers) (1,3)

LD50 (oral, 14-day old rat): 15840 mg/kg (3)

LD50 (oral, young rat): 32340 mg/kg (3)

LD50 (oral, adult rat): 28700 mg/kg (3,16)

SECTION 12) ECOLOGICAL INFORMATION

Toxicity

Toxic to aquatic life with long lasting effects.

Persistence and Degradability

No data available.

Bio-Accumulative Potential

No data available.

Mobility in Soil

No data available.

Other Adverse Effects

No data available.

Results of the PBT and vPvB assessment

No data available.

SECTION 13) DISPOSAL CONSIDERATIONS

Waste Disposal

Under RCRA, it is the responsibility of the user of the product, to determine at the time of disposal whether the product meets RCRA criteria for hazardous waste. Waste management should be in full compliance with federal, state, and local laws.

Empty containers retain product residue which may exhibit hazards of material, therefore do not pressurize, cut, glaze, weld or use for any other purposes. Return drums to reclamation centers for proper cleaning and reuse.

SECTION 14) Transport Information

| | U.S. DOT Information | IMDG Information | IATA Information |
|------------------------------|-------------------------|------------------|----------------------------|
| UN number: | UN1950 | UN1950 | UN1950 |
| Proper shipping name: | Aerosols | Aerosols | Aerosols, non-flammable |
| Hazard class: | 2.2 | 2.2 | 2.2 |
| Packaging group: | N.A. | N.A. | N.A. |
| Note / Special Provision: | (LTD QTY) | (LTD QTY) | (LTD QTY) |

SECTION 15) REGULATORY INFORMATION

| CAS | Chemical Name | % By Weight | Regulation List |
|--------------|---------------------------------------|-------------|---|
| 0000110-54-3 | HEXANE | 38% - 63% | SARA313, CERCLA, HAPS, SARA312, VOC, TSCA, ACGIH, California Proposition 65, OSHA |
| 0063148-62-9 | Silicone | 17% - 29% | SARA312, TSCA |
| 0068476-86-8 | Petroleum gases, liquefied, sweetened | 14% - 23% | SARA312, TSCA, OSHA |
| 0008050-26-8 | Resin glycerine ester | 0.0% - 0.5% | SARA312, TSCA |

SECTION 16) OTHER INFORMATION


Glossary

ACGIH- American Conference of Governmental Industrial Hygienists; ANSI- American National Standards Institute; Canadian TDG- Canadian Transportation of Dangerous Goods; CAS- Chemical Abstract Service; Chemtrec- Chemical Transportation Emergency Center (US); CHIP- Chemical Hazard Information and Packaging; DSL- Domestic Substances List; EC- Equivalent Concentration; EH40 (UK)- HSE Guidance Note EH40 Occupational Exposure Limits; EPCRA- Emergency Planning and Community Right-To-Know Act; ESL- Effects screening levels; HMIS- Hazardous Material Information Service; LC- Lethal Concentration; LD- Lethal Dose; NFPA- National Fire Protection Association; OEL- Occupational Exposure Limits; OSHA- Occupational Safety and Health Administration, US Department of Labor; PEL- Permissible Exposure Limit; SARA (Title III)- Superfund Amendments and Reauthorization Act; SARA 313- Superfund Amendments and Reauthorization Act, Section 313; SCBA- Self-Contained Breathing Apparatus; STEL- Short Term Exposure Limit; TCEQ- Texas Commission on Environmental Quality; TLV- Threshold Limit Value; TSCA- Toxic Substances Control Act Public Law 94-469; TWA- Time Weighted Value; US DOT- US Department of Transportation; WHMIS- Workplace Hazardous Materials Information System.

HMIS

| | |
|---------------------|-----|
| Health | / 3 |
| FLAMMABILITY | 4 |
| Physical Hazard | 3 |
| Personal Protection | B |

NFPA

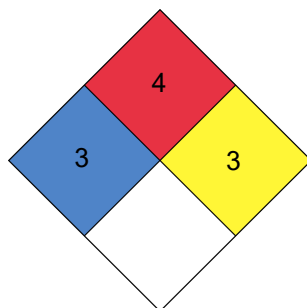

(*) - Chronic effects

Caution: HMIS® ratings are based on a 0-4 rating scale, with 0 representing minimal hazards or risks, and 4 representing significant hazards or risks

DISCLAIMER

To the best of our knowledge, the information contained herein is accurate. However, neither the above named supplier nor any of its subsidiaries assumes any liability whatsoever for the accuracy or completeness of the information contained herein. Final determination of suitability of any material is the sole responsibility of the user. All materials may present unknown hazards and should be used with caution. Although certain hazards are described herein, we cannot guarantee that these are the only hazards that exist. The above information pertains to this product as currently formulated, and is based on the information available at this time. Addition of reducers or other additives to this product may substantially alter the composition and hazards of the product. Since conditions of use are outside our control, we make no warranties, express or implied, and assume no liability in connection with any use of this information.